
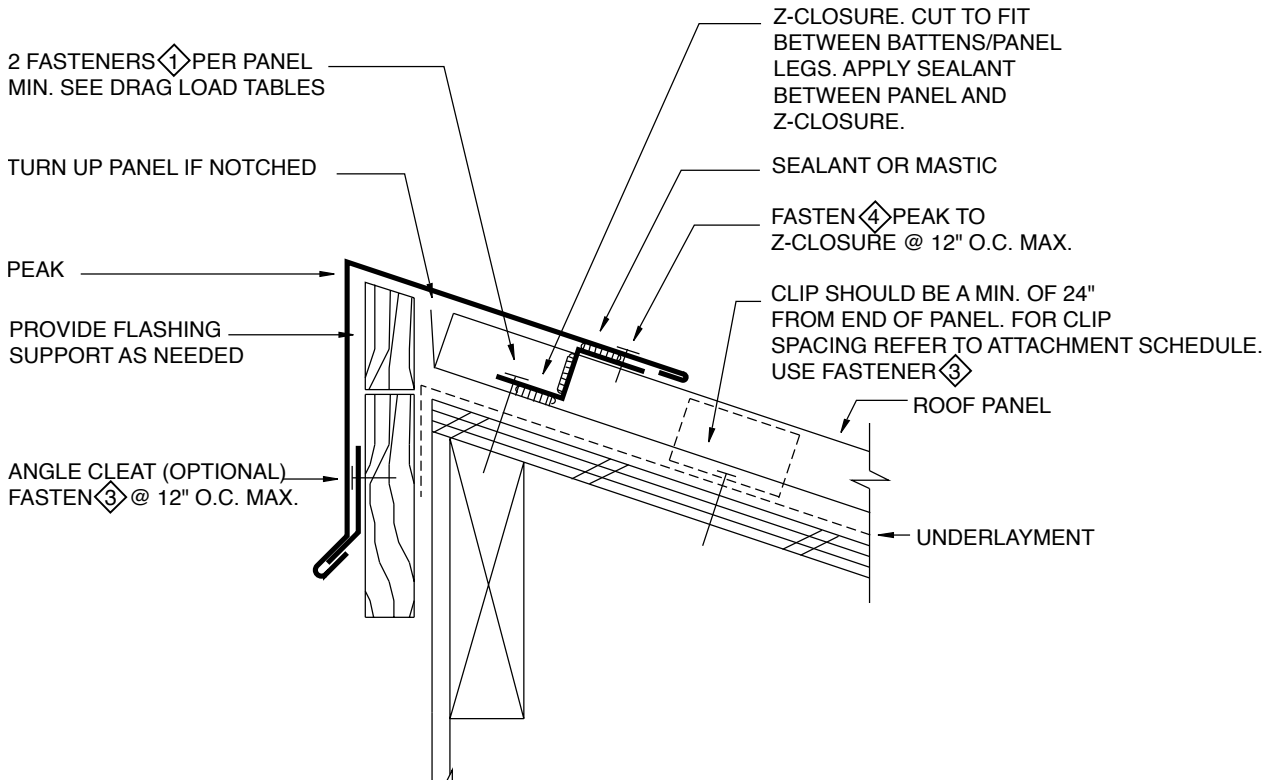


## Peak Flashing

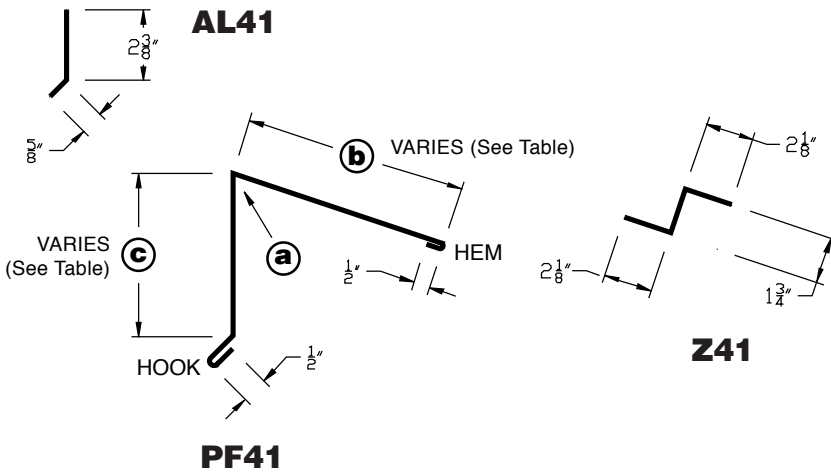

## Procedures

- Turn up end of panels if notched.
- Locate angle cleat and fasten before installing the peak flashing. If the angle cleat is not used, fasten through the vertical leg of the peak with a #14x1" metal to wood screw every 24" o.c. max.
- Locate the panels down from the peak as required and position Z closure so that the peak flashing will conceal it.
- Caulk (ProSeal 34 is recommended) top, sides, and bottom of the Z Closure. Check the overlap at the eave before fastening the Z Closure to the substrate.
- Fasten Z Closure to substrate and fasten peak flashing to the Z Closure.
- Caulk (ProSeal 34 is recommended), lap, and rivet sequential flashings. We recommend that maximum accumulated length of flashings do not exceed 40 ft.